



# TIME OF TRANSFER INSPECTION TOT# 2162 DANIEL MICHEL CERT # 11791

## Site Information

Parcel Description: **121025300011000**

Address: **12251 182nd Ave, Maquoketa, IA 52060**

County: **Jackson**

## Owner Information

Property is owned by a business: **No**

Business Name:

Owner Name: **Bruce Manning**

Email Address:

Address: **12480 182nd Ave, Maquoketa, IA 52060**

Phone No:

## Site related information

No Of Bedrooms: **3**

Inspection Date: **09/13/2022**

Facility Type: **Residential**

Currently Occupied: **Yes**

Last Occupied:

System Installation Date:

Permit issued by County: **N/A**

Permit Number:

All plumbing fixtures enter septic system: **Yes**

County contacted for records: **Yes**

Property Information Comments:

## Primary Treatment

### Tank 1

Tank Name: **Tank 1**

Type: **Septic Tank**

Tank Size (Gal): **1000**

Tank Material: **Concrete**

Tank Corrosion Type: **Slight**

Liquid Level Type: **Normal**

No. of Compartments: **2**

Pump Tank Chamber: **No**

Licensed Pumper Name: **Michel Septic**

Date Pumped: **9/13/2022**

Meets Setback to Well: **Yes**

Well Type: **Private**

Distance To Well (Ft.): **50**

Is Accessible: **Yes**

Lid Intact: **Yes**

Risers Intact: **Yes**

Effluent Filter Present: **No**

Watertight: **Yes**

coming out of it all accepting effluent evenly and adequately during the hydraulic load test.

**Hydraulic Test** – Since this is a 3-bedroom residence I conducted a hydraulic load test on the drain field by running 250 gallons of water in the system for roughly 50min @ 5 gal/min. The system showed no signs of ponding when I probed each line and accepted effluent evenly and adequately during the test.

**Other Components:** N/A


**Setbacks:** The tank is over 50' from the closest well and the field is over 100' away from the closest well. The system is entirely on the same parcel.

**Summary:** At the time of inspection the system appears to be functioning as designed. However, this report is being forwarded to the County Health Department for review. This letter will need to be filed along with this report.

**Disclaimer:**

The information provided is honest, thorough, and, to the best of my knowledge and ability correct.


Certified by Daniel Michel #11791

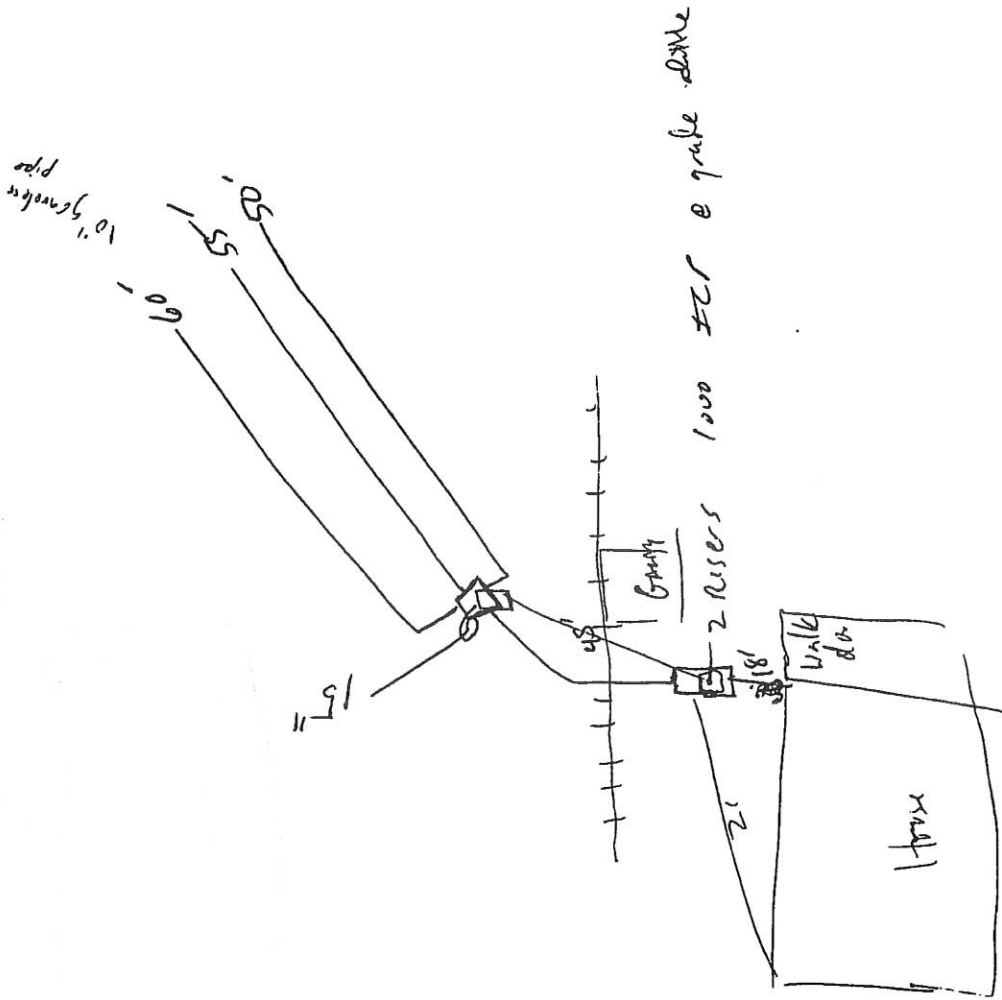

3

9/5  
 Manning  
 / Bob Miller

SEPTIC SYSTEM DIAGRAM FOR DEUCE MANNING @  
 12410 182nd AVE NARROGATA IA  
 12251

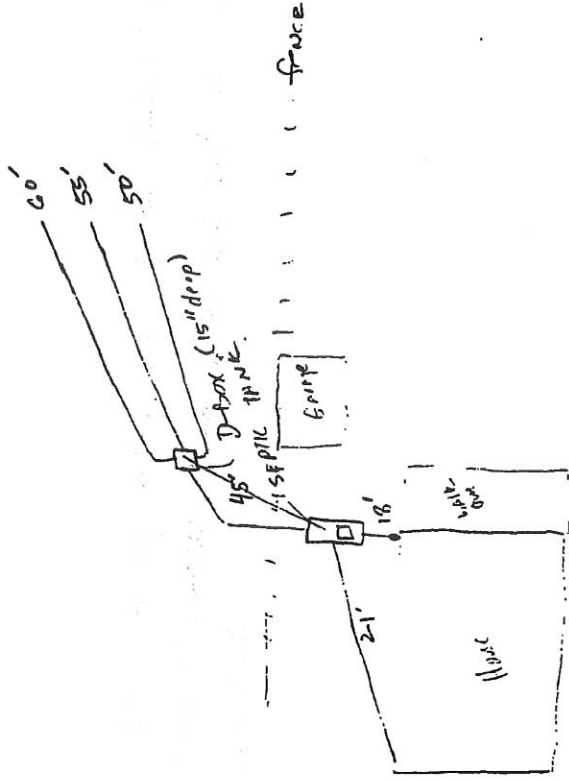

\* SEPTIC SYSTEM INSTALLED 9/95 BY BOB MILLER P.M.B. SYSTEM CONSISTS OF A  
 1000 gal comm. septic tank w/ 2 RISERS. Ground D-box and 160' of 10" gravelles  
 pipe installed for drainfield.